SONY

Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services A Division of Sony Corporation of America Sony Drive, Park Ridge, New Jersey 07656

Model: All CDP/CDP-C

No. 286R1

Subject: Will Not Play Disc / Skips After Optical Block Replacement

Date: November 24, 1992

This bulletin supersedes Hi-Fi Service Bulletin No.286

Symptom: (12)


Unit will not read TOC or unit will skip after optical block has been replaced.


Solution:

 
Focus Bias is out of adjustment. Adjust focus bias pot on optical block KSS-240A as follows:

1. Use a YEDS-18 disc.

2. Adjust the focus bias pot for the clearest eye pattern.

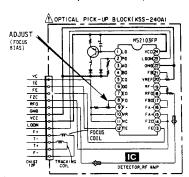

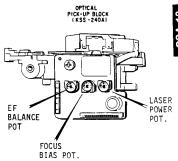



Clear RF signal waveform means that the shape " \diamondsuit " can be clearly distinguished at the center of the waveform.