

Service-Bulletin

Washing machines

599 524 285

EN

Toploader

Air gap left and right between upper part and front panel.

Cause: Toleranzprobleme.



Measure: Remove the left and right side panel.
Remove the left and right screw.
Press together upper part and front panel.



Bend both brackets at the front panel to the inside and tighten them again with the screws.
Fasten the left and the right side panel.
Tighten both upper screws with a attenuation part ref. 129307201/1.

