

This file is provided FREE OF CHARGE from the
electromaniacs.com community

You are free to distribute this file to other persons
who needs it , but without of charge

Also on <http://electromaniacs.com> you can find
thousands of service manuals , schematics free of
charge



VESTEL Service Bulletin

Model: All models with AK37 Chassis.	<u>Service Bulletin No:</u> 122	Priority () S. All product. () A. Items in Customer / Dealer stock / Service return goods. () B. Customer stock / Units returned for Service. (X) C. Sold items returned for Service. () D. Only Units returned to this bulletin. () E. Others
SUBJECT : IC 800 defect		DATE : August 07, 2002

<Objective>

Please modify if following symptom occurs

<Symptom>

TV does not work due to IC800 broke down

<Cause>

Spikes on main power affects and disturbs to IC 800.

<Countermeasures>

After changing the defected IC800,

In order to improve IC 800 resistant to spikes, modify the chassis as given below.

Replace,

R801 RES CF 1/4W 1K J ==> RES CF 1/4W 4.7K J

C860 CAP CER 100NF 100V ==> CAP MKT 47NF 250V J .

<Spare Parts order>

R801: VE-30000718

C860: VE-30000107

<Start Date of Modification on Production.>

26.05.2002